



N9105-L100

N Reverse Polarity Jack Crimp For Bulkhead 50Ω

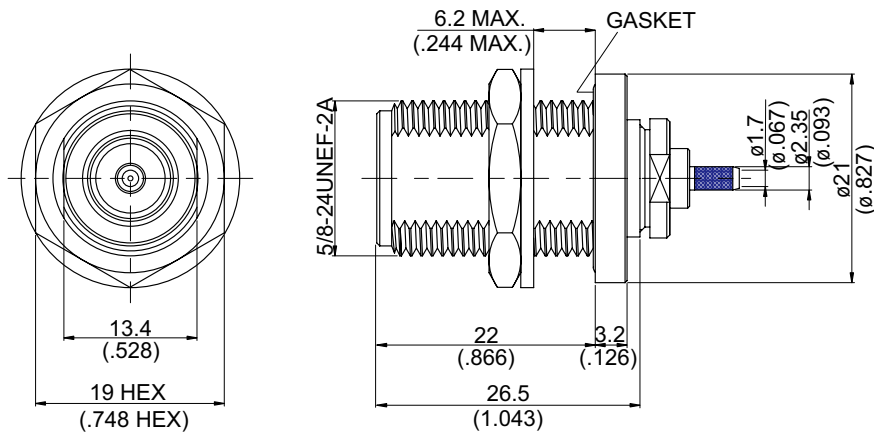

MOUNTING HOLE

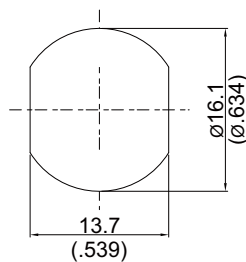

Parts	Material	Plating (Micro-inch)
Hex Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Lock Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Crimp Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Teflon	
Contact Pin	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight: 37.6g

Suitable Cables: JBY100

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

N9105-L100

JYE BAO CO., LTD.

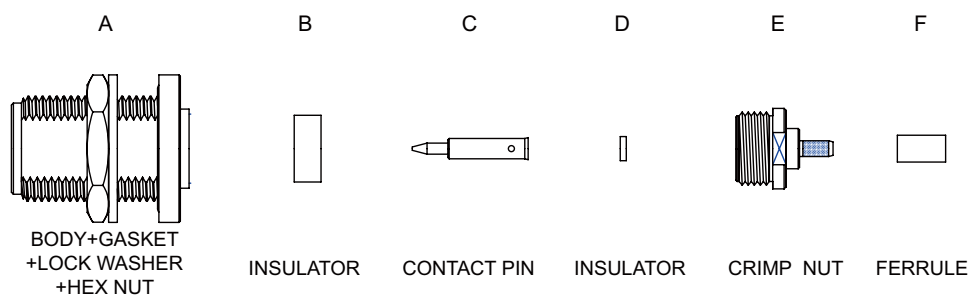


DIAGRAM	ASSEMBLY INSTRUCTION
	Step 1: STRIP AS SHOWN.
	Step 2: SLIDE "F" OVER CABLE. Step 3: LOOSEN BRAIDING AND SLIDE "E" IN PLACE.
	Step 4: PUT INSULATOR "D" AND CONTACT PIN "C" ON CENTER CONDUCTOR AND SOLDER IN "Y".
	Step 5: SLIDE INSULATOR "B" INTO CONNECTOR BODY "A".
	Step 6: SCREW "E" ON THE CONNECTOR BODY "A". Step 7: SLIDE FERRULE "F" TOWARDS "E" AND CRIMP.

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.