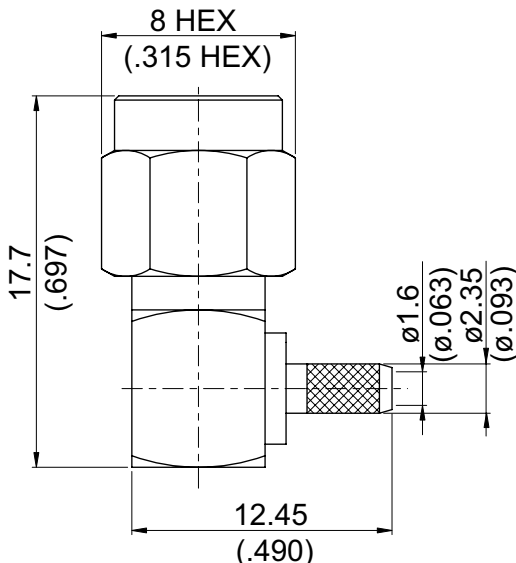


SMA3100-9316	SMA Plug Crimp Right Angle For RG174,RG188,RG316; 11GHz VSWR 1.25 50Ω																															
																																
<table><tr><th>Parts</th><th>Material</th><th>Plating (Micro-inch)</th></tr><tr><td>Ferrule</td><td>Copper</td><td>Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20</td></tr><tr><td>Cover</td><td>Brass</td><td>Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20</td></tr><tr><td>Renbrock Ring</td><td>Beryllium Copper</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Gasket</td><td>Silicon</td><td></td></tr><tr><td>Contact Pin</td><td>Brass</td><td>Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20</td></tr><tr><td>Insulator</td><td>Teflon</td><td></td></tr><tr><td>Barrel</td><td>Brass</td><td>Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20</td></tr><tr><td>Body</td><td>Brass</td><td>Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20</td></tr><tr><td>Coupling Nut</td><td>Brass</td><td>Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20</td></tr></table>			Parts	Material	Plating (Micro-inch)	Ferrule	Copper	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20	Cover	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20	Renbrock Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Gasket	Silicon		Contact Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20	Insulator	Teflon		Barrel	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20	Body	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20	Coupling Nut	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Parts	Material	Plating (Micro-inch)																														
Ferrule	Copper	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20																														
Cover	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20																														
Renbrock Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50																														
Gasket	Silicon																															
Contact Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20																														
Insulator	Teflon																															
Barrel	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20																														
Body	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20																														
Coupling Nut	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20																														
Weight: 4.8 g Suitable Cables: RG174, RG188, RG316, RG316-FEP																																

This part number complies with RoHS.

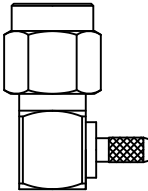
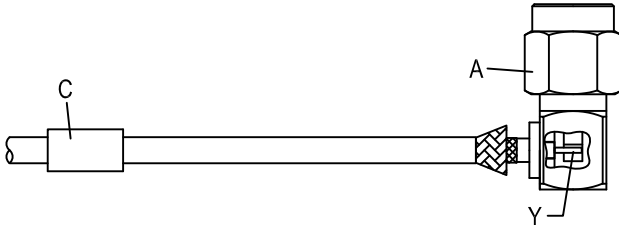
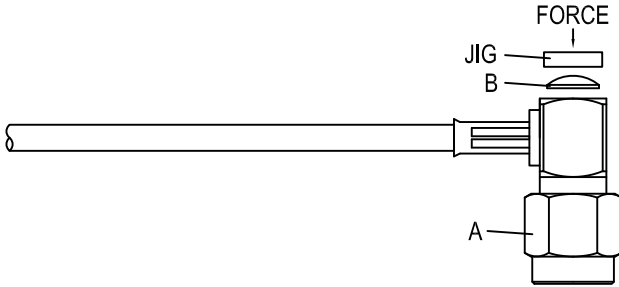
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

SMA	SMA3100-9316
Interface MIL-STD-348B Mechanically compatible with 2.92 & 3.5	
Electrical Data Impedance 50Ω Frequency range DC to 11GHz VSWR ≤ 1.25 (DC to 11GHz) Insertion loss $\leq 0.04 \times \sqrt{f(\text{GHz})}$ dB Insulation resistance $\geq 5000\text{M}\Omega$ Contact resistance inner conductor $\leq 3\text{m}\Omega$ Contact resistance outer conductor $\leq 2\text{m}\Omega$ Dielectric withstanding voltage (at sea level) 750 V rms Working voltage (at sea level) 250 V rms	
Mechanical Data Recommended coupling nut torque 4 inch lbs Coupling proof torque 5.3 inch lbs Coupling nut retention force ≥ 60.7 lbs Contact Captivation-axial ≥ 6.1 lbs Durability (mating) ≥ 100	
Environmental Data Temperature range -65°C to +165°C Thermal shock MIL-STD-202, Method 107, Condition B Moisture resistance MIL-STD-202, Method 106 Corrosion MIL-STD-202, Method 101, Condition B RoHS Compliant	
Tooling Crimping tool CRT-1 or CRT-2 Crimp insert INSERT-A	

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

SMA3100-9316		DATE	2020/04/20	REV	—
A  BODY B  COVER C  FERRULE					
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: WRAP THE BRAIDING UPWARDS. Step 4: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR " A " AND SOLDER IN " Y ".		
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 3.3mm/0.130inch HEX SECTION OF INSERT-A)		
			Step 6: PRESS ON THE TOP OF " B " WITH JIGS.		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	

SMA3100-9316

