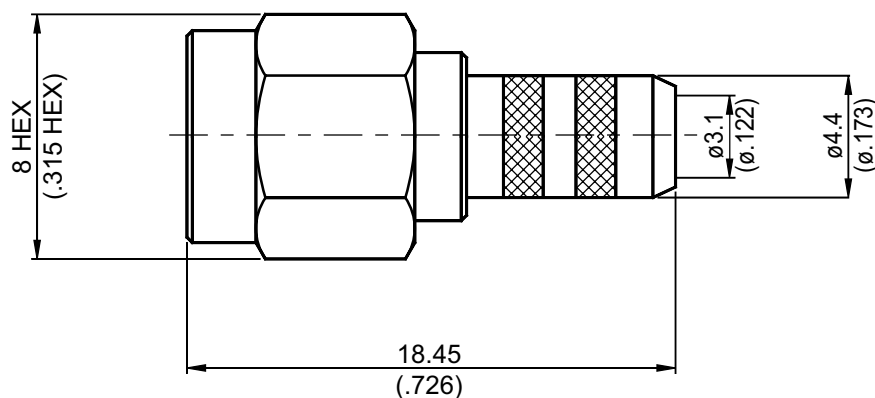


SMA3100S-0058

SMA Plug Crimp For RG58, JBY195, LMR195 50Ω
6GHz VSWR 1.2*



*Using JBY195

Parts	Material	Plating (Micro-inch)
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Renber Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Insulator	Teflon	
Body	Stainless	Passivated
Coupling Nut	Stainless	Passivated

Weight: 3.85 g
Suitable Cables: RG58, JBY195, LMR195

This part number complies with RoHS.



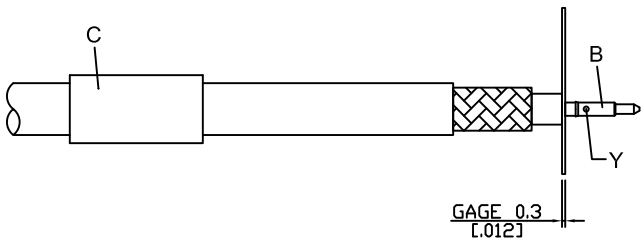
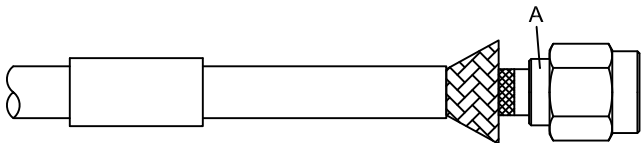
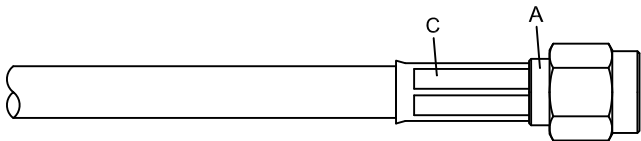
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

SMA	SMA3100S-0058
Interface MIL-STD-348B Mechanically compatible with 2.92 & 3.5	
Electrical Data Impedance 50Ω Frequency range DC to 6GHz VSWR ≤ 1.2 (DC to 6GHz) Insertion loss $\leq 0.04 \times \sqrt{f(\text{GHz})}$ dB Insulation resistance $\geq 5000\text{M}\Omega$ Contact resistance inner conductor $\leq 3\text{m}\Omega$ Contact resistance outer conductor $\leq 2\text{m}\Omega$ Dielectric withstanding voltage (at sea level) 1000 V rms Working voltage (at sea level) 335 V rms	
Mechanical Data Recommended coupling nut torque 7 to 9.5 inch lbs Coupling proof torque 15 inch lbs Coupling nut retention force ≥ 60.7 lbs Contact Captivation-axial ≥ 6.1 lbs Durability (mating) ≥ 500	
Environmental Data Temperature range -65°C to +165°C Thermal shock MIL-STD-202, Method 107, Condition B Moisture resistance MIL-STD-202, Method 106 Corrosion MIL-STD-202, Method 101, Condition B RoHS Compliant	
Tooling Crimping tool CRT-1 or CRT-2 Crimp insert INSERT-B Soldering gauge ST-0.3	

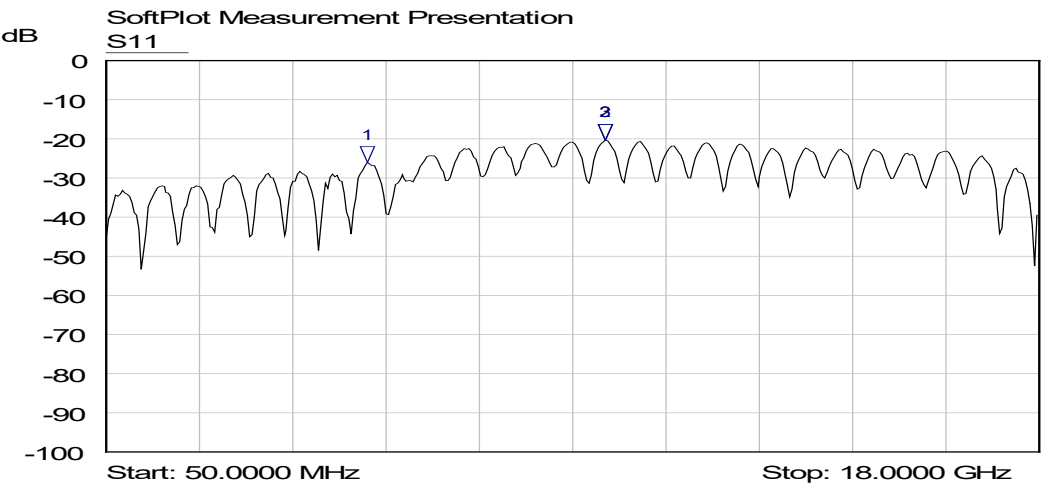
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY RECOMMENDATION

SMA3100S-0058		DATE	2017/11/01	REV	—
A B C    BODYCONTACT PINFERRULE					
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: PUT 0.3 MM GAGE IN PLACE, INSERT CABLE'S CENTER CONDUCTOR INTO CENTER PIN " B " AND SOLDER IN " Y ".		
			Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE.		
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 5.5mm/0.217Inch HEX SECTION OF INSERT-B)		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	

SMA3100S-0058 (using JBY195)



Mkr	Trace	X-Axis	Value	Notes
1 ▽	S11	5.0715 GHz	-26.08 dB	
2 ▽	S11	9.6487 GHz	-20.29 dB	
3 ▽	S11	9.6487 GHz	-20.29 dB	