


SMA3100S-L100

SMA Plug Crimp For JBY100,LMR100
6GHz VSWR 1.2

50Ω

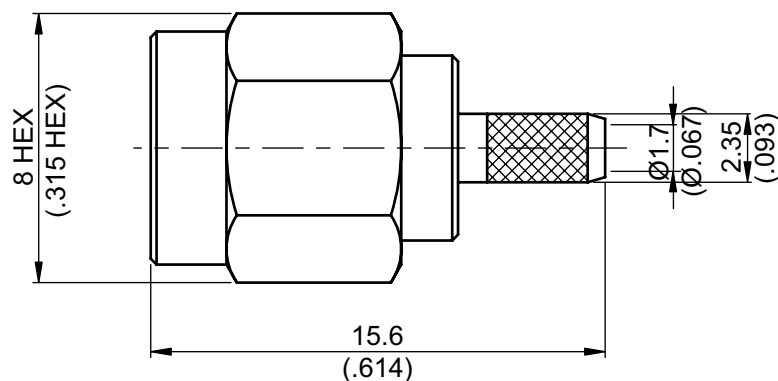

Parts	Material	Plating (Micro-inch)
Ferrule	Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Renber Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Insulator	Teflon	
Body	Stainless	Passivated
Coupling Nut	Stainless	Passivated

Suitable Cables:JBY100,LMR100

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

SMA	SMA3100S-L100
Interface MIL-STD-348B Mechanically compatible with 2.92 & 3.5	
Electrical Data Impedance 50Ω Frequency range DC to 6GHz VSWR ≤ 1.2 (DC to 6GHz) Insertion loss $\leq 0.04 \times \sqrt{f(\text{GHz})}$ dB Insulation resistance $\geq 5000\text{M}\Omega$ Contact resistance inner conductor $\leq 3\text{m}\Omega$ Contact resistance outer conductor $\leq 2\text{m}\Omega$ Dielectric withstanding voltage (at sea level) 750 V rms Working voltage (at sea level) 250 V rms	
Mechanical Data Recommended coupling nut torque 7 to 9.5 inch lbs Coupling proof torque 15 inch lbs Coupling nut retention force ≥ 60.7 lbs Contact Captivation-axial ≥ 6.1 lbs Durability (mating) ≥ 500	
Environmental Data Temperature range -65°C to +165°C Thermal shock MIL-STD-202, Method 107, Condition B Moisture resistance MIL-STD-202, Method 106 Corrosion MIL-STD-202, Method 101, Condition B RoHS Compliant	
Tooling Crimping tool CRT-1 or CRT-2 Crimp insert INSERT-A Soldering gauge ST-0.3	


Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

SMA3100S-L100		DATE	2021/08/15	REV	—
A BODY B CONTACT PIN C FERRULE					
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE "C" OVER CABLE. Step 3: PUT 0.4 MM GAGE ST-0.4 IN PLACE, INSERT CABLE'S CENTER CONDUCTOR INTO CENTER PIN "B" AND SOLDER IN "Y". (USE SQUARE 0.98mm/0.039inch SECTION OF INSERT-A IF CRIMPED)		
			Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR "A" IN PLACE.		
			Step 5: SLIDE FERRULE "C" TOWARDS THE CONNECTOR "A" AND CRIMP. (USE 3.3mm/0.130inch HEX SECTION OF INSERT-A)		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	

SMA3100S-L100

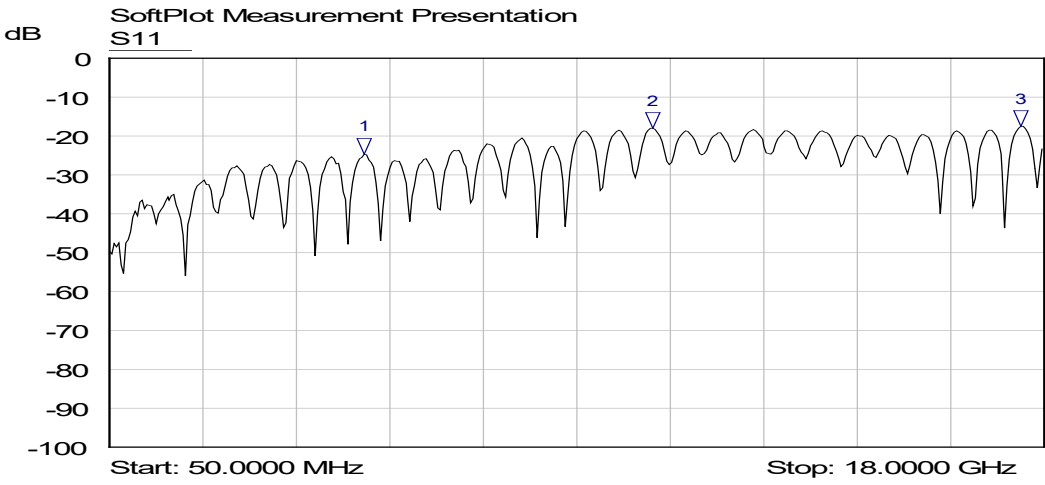

Mkr	Trace	X-Axis	Value	Notes
1 ▽	S11	4.9382 GHz	-24.72 dB	
2 ▽	S11	10.4930 GHz	-17.92 dB	
3 ▽	S11	17.5587 GHz	-17.42 dB	