



SMA3362Q-9141/W

Snap on SMA plug solder
2 hole flange right angle for RG402

50Ω

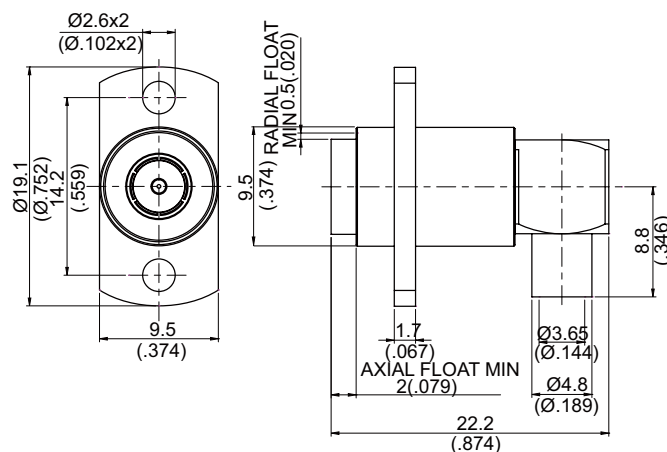

MOUNTING HOLES

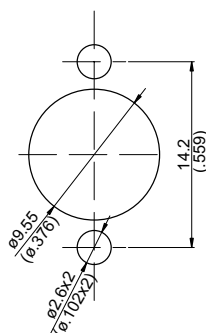

Parts	Material	Plating (Micro-inch)
Cover	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Brass	Gold 4 Over Nickel-Phosphorous Alloy 80 Over Copper 20
Washer	Stainless	
Spring	Stainless	
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight:

Suitable Cables:Semi-rigid.141


This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

SMA3362Q-9141/W

JYE BAO CO., LTD.

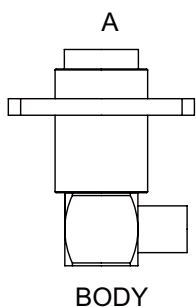


DIAGRAM


ASSEMBLY INSTRUCTION




Step 1: STRIP AS SHOWN .

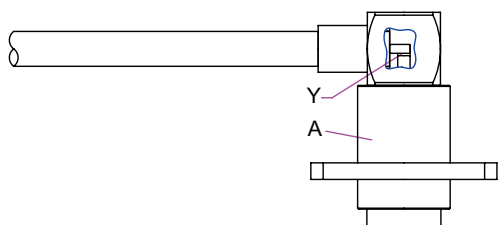

Step 2: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR "A" AND SOLDER IN "Y".

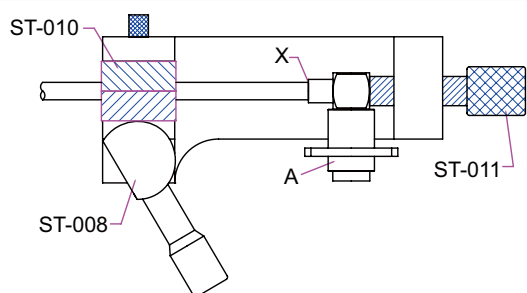

Step 3: INSERT PREPARED CABLE INTO SOLDERING FIXTURE "ST-008". USE INSERT TOOL "ST-010" AND LOCATOR TOOL "ST-011" TO FIX THE CONNECTOR. SOLDER IN "X".

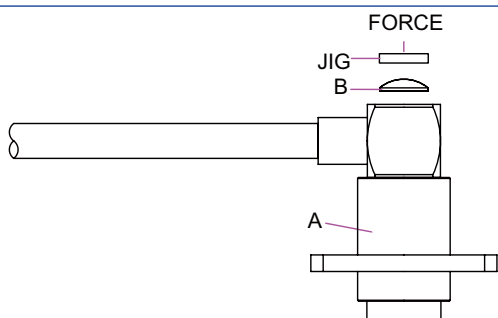

Step 4: PRESS ON THE TOP OF "B" WITH JIGS .

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.