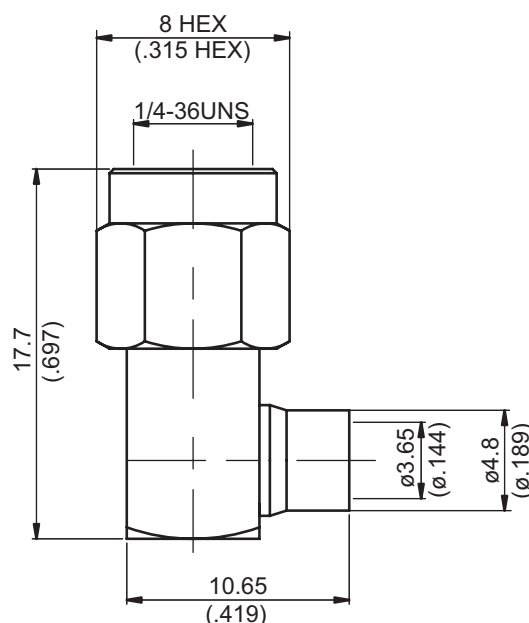


SMA6300-9141

SMA Reverse Polarity Plug Solder Right Angle
For RG402; 11GHz VSWR 1.25

50Ω



Parts	Material	Plating (Micro-inch)
Cover	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Retainer Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Contact Pin	Beryllium Copper	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Insulator	Teflon	
Barrel	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Body	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Coupling Nut	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20

Suitable Cables: Semi-rigid.141

This part number complies with RoHS.

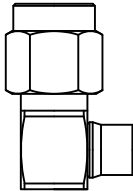

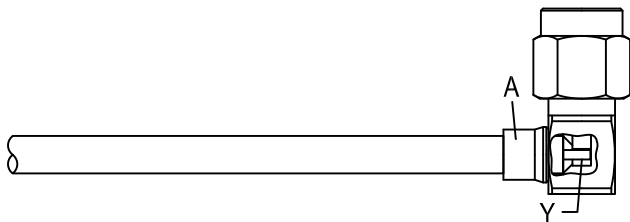
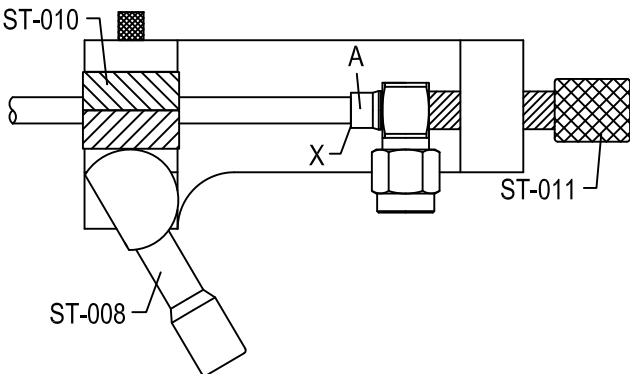
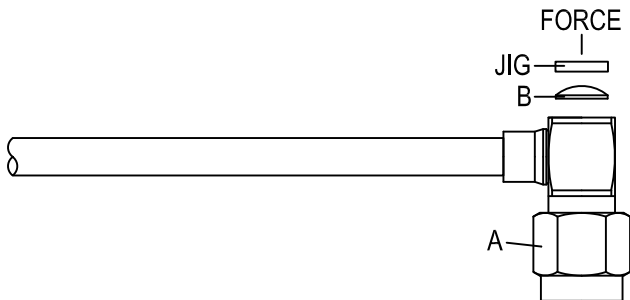
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

SMA	SMA6300-9141
Interface Per JYEBAO SMA Reverse Polarity Plug derived from MIL-STD-348B	
Electrical Data	
Impedance	50Ω
Frequency range	DC to 11GHz
VSWR	≤ 1.25 (DC to 11GHz)
Insertion loss	$\leq 0.04 \times \sqrt{f(\text{GHz})}$ dB
Insulation resistance	$\geq 5000\text{M}\Omega$
Contact resistance inner conductor	$\leq 3\text{m}\Omega$
Contact resistance outer conductor	$\leq 2\text{m}\Omega$
Dielectric withstanding voltage (at sea level)	1500 V rms
Working voltage (at sea level)	500 V rms
Mechanical Data	
Recommended coupling nut torque	4 inch lbs
Coupling proof torque	5.3 inch lbs
Coupling nut retention force	≥ 60.7 lbs
Contact Captivation-axial	≥ 6.1 lbs
Durability (mating)	≥ 100
Environmental Data	
Temperature range	-65°C to +165°C
Thermal shock	MIL-STD-202, Method 107, Condition B
Moisture resistance	MIL-STD-202, Method 106
Corrosion	MIL-STD-202, Method 101, Condition B
RoHS	Compliant
Tooling	
Locator tool	ST-011
Soldering fixture	ST-008
Insert for .141inch semi-rigid cable	ST-010

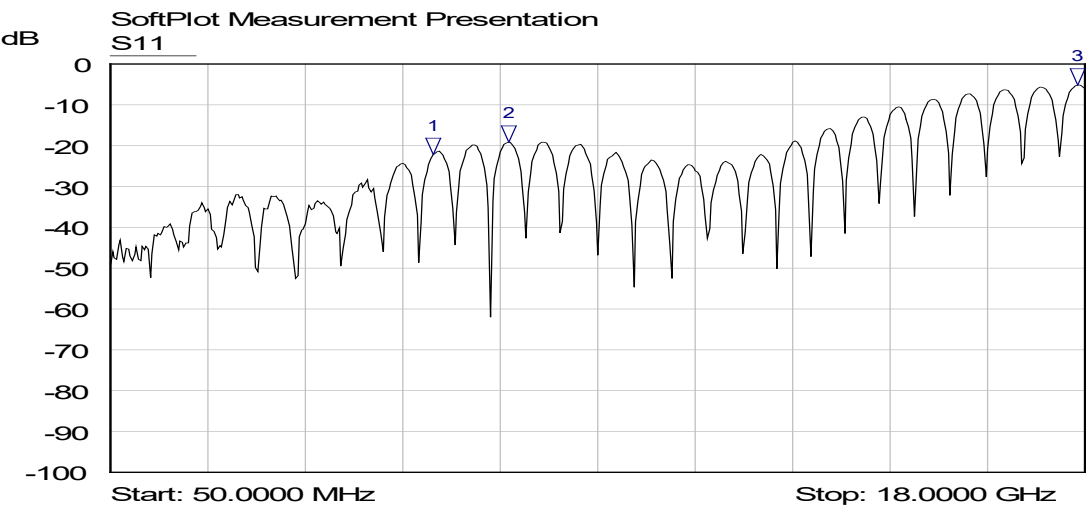
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

SMA6300-9141		DATE	2017/12/01	REV	—
A  BODY		B  COVER			
DIAGRAM		ASSEMBLY INSTRUCTION			
		Step 1: STRIP AS SHOWN.			
		Step 2: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR " A " AND SOLDER IN " Y ".			
		Step 3: USE SOLDERING FIXTURE " ST-008 ", INSERT TOOL " ST-010 " AND LOCATOR TOOL " ST-011 " TO FIX THE CONNECTOR. SOLDER IN " X ".			
		Step 4: PRESS ON THE TOP OF " B " WITH JIGS.			
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	

SMA6300-9141



Mkr	Trace	X-Axis	Value	Notes
1 ▽	S11	5.9876 GHz	-22.19 dB	
2 ▽	S11	7.3804 GHz	-19.19 dB	
3 ▽	S11	17.8628 GHz	-5.16 dB	