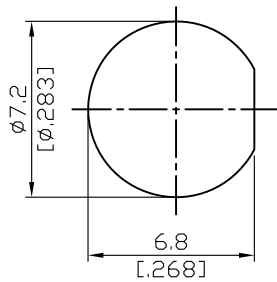
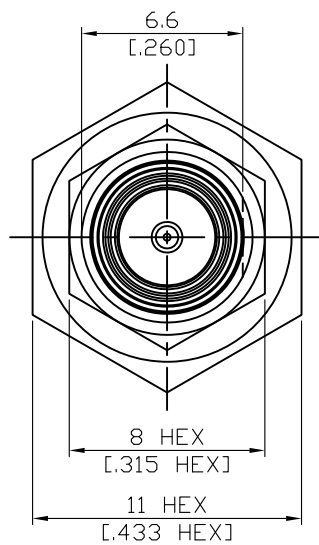


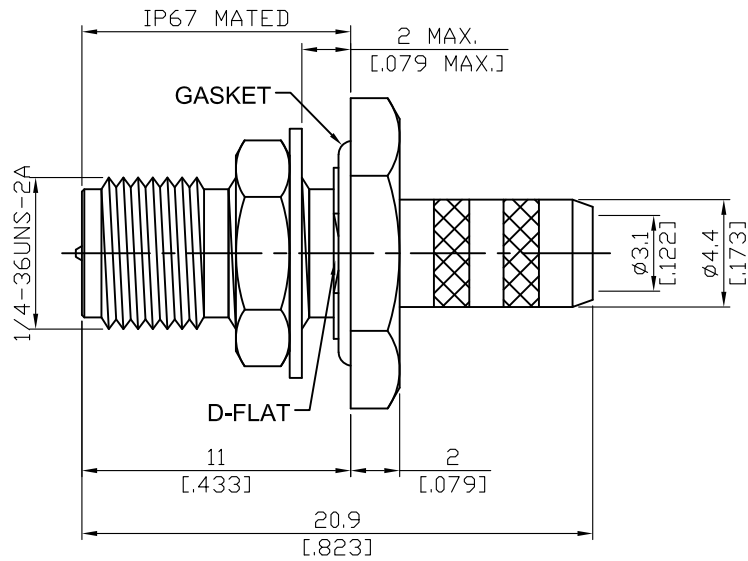
SMA9105-0223

SMA reverse polarity jack crimp bulkhead,
IP67 mated, for RG223; 6GHz VSWR 1.2

50Ω



MOUNTING HOLE



Parts	Material	Plating (Micro-inch)
Ferrule	Copper	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Hex Nut	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Lock Washer	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Gasket	Silicone	
Contact Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Insulator	Teflon	
Body	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20

Suitable Cables: RG223

This part number complies with RoHS.

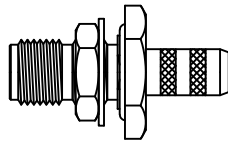
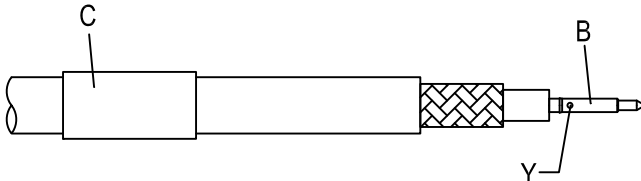
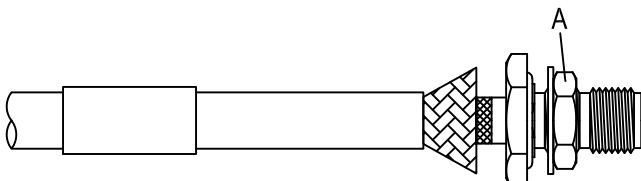
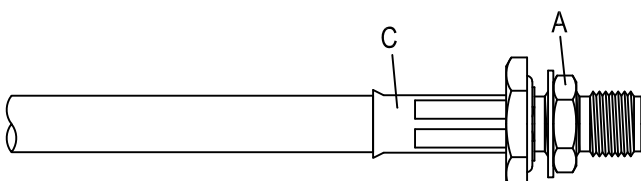
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

SMA	SMA9105-0223
Interface Per JYEBAO SMA Reverse Polarity Jack derived from MIL-STD-348B	
Electrical Data	
Impedance	50Ω
Frequency range	DC to 6GHz
VSWR	≤ 1.2 (DC to 6GHz)
Insertion loss	$\leq 0.04 \times \sqrt{f(\text{GHz})}$ dB
Insulation resistance	$\geq 5000\text{M}\Omega$
Contact resistance inner conductor	$\leq 3\text{m}\Omega$
Contact resistance outer conductor	$\leq 2\text{m}\Omega$
Dielectric withstanding voltage (at sea level)	1000V rms
Working voltage (at sea level)	335V rms
Mechanical Data	
Recommended coupling nut torque	4 inch lbs
Coupling proof torque	5.3 inch lbs
Contact Captivation-axial	≥ 6.1 lbs
Durability (mating)	≥ 100
Environmental Data	
Temperature range	-65°C to +165°C
Thermal shock	MIL-STD-202, Method 107, Condition B
Moisture resistance	MIL-STD-202, Method 106
Corrosion	MIL-STD-202, Method 101, Condition B
RoHS	Compliant
Tooling	
Crimping tool	CRT-1 or CRT-2
Crimp insert	INSERT-B
Soldering gauge	ST-0.4

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

SMA9105-0223		DATE	2016/07/20	REV	—
A		B		C	
					
BODY + GASKET + WASHER + HEX NUT		CONTACT PIN		FERRULE	
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: PUT PIN " B " ON CENTER CONDUCTOR AND SOLDER OR CRIMP IN " Y ". USE 0.4MM GAGE ST-0.4 (USE SQUARE 0.98mm/0.039inch SECTION OF INSERT-B IF CRIMPED)		
			Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE.		
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 5.9mm/0.232inch HEX SECTION OF INSERT-B)		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	

SMA9105-0223

S11

