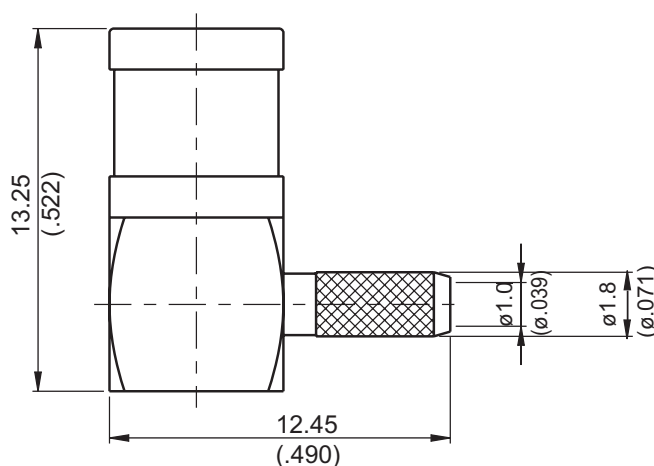


SMB3100A-9178

SMB Plug Crimp Right Angle
For RG178,RG178-FEP, 1GHz VSWR 1.2

50Ω



Parts	Material	Plating (Micro-inch)
Cover	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Ferrule	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Retainer Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Beryllium Copper	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Insulator	Teflon	
Body	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Barrel	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Coupling Nut	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20

Weight: 2.92 g

Suitable Cables: RG178, RG178-FEP

This part number complies with RoHS.

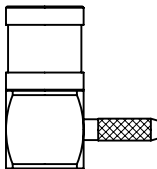
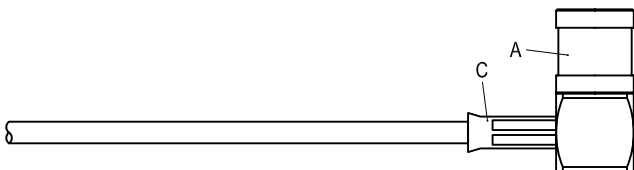
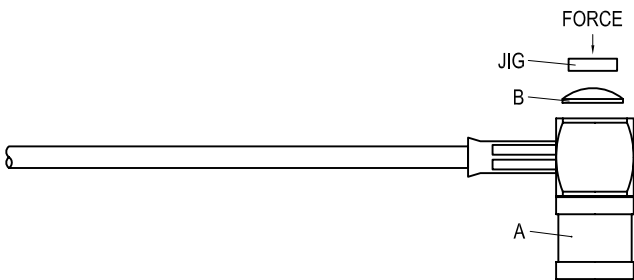
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

SMB	SMB3100A-9178
Interface MIL-STD-348B Mechanically compatible with SMS	
Electrical Data Impedance 50Ω Frequency range DC to 1GHz VSWR ≤ 1.2 (DC to 1GHz) Insertion loss $\leq 0.1 \times \sqrt{f(\text{GHz})}$ dB Insulation resistance $\geq 10000\text{M}\Omega$ Contact resistance inner conductor $\leq 5\text{m}\Omega$ Contact resistance outer conductor $\leq 2.5\text{m}\Omega$ Dielectric withstanding voltage (at sea level) 750V rms Working Voltage (at sea level) 250V rms	
Mechanical Data Disengagement force 1.8 to 14.2 lbs Engagement force 1.8 to 14.2 lbs Contact captivation-axial ≥ 4 lbs Durability (mating) ≥ 500	
Environmental Data Temperature range -65°C to +165°C Thermal shock MIL-STD-202, Method 107, Condition B Moisture resistance MIL-STD-202, Method 106 Corrosion MIL-STD-202, Method 101, Condition B RoHS Compliant	
Tooling Crimping tool CRT-1 or CRT-2 Crimp insert INSERT-A	

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

SMB3100A-9178		DATE	2016/08/22	REV	—
A  BODY B  COVER C  FERRULE					
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: WRAP THE BRAIDING UPWARDS. Step 4: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR " A " AND SOLDER IN " Y ".		
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 2.7mm/0.106inch HEX SECTION OF INSERT-A)		
			Step 6: PRESS ON THE TOP OF " B " WITH JIGS.		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	

SMB3100A-9178

S11

