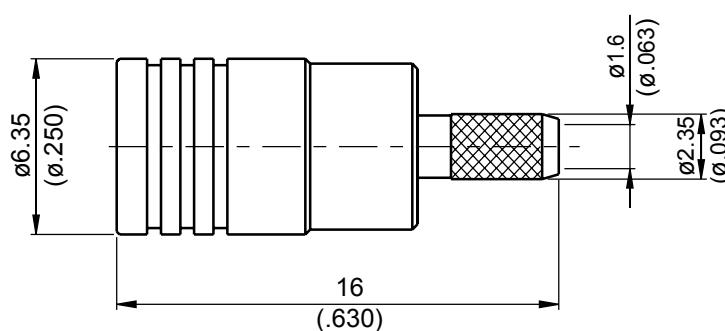


SMB3100D-0316	SMB Plug Crimp For RD316,RD316-FEP 2GHz VSWR 1.2	50Ω
---------------	---	-----



Parts	Material	Plating (Micro-inch)
Ferrule	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Contact Pin	Beryllium Copper	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Retainer Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Teflon	
Body	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20

Weight: 2 g
Suitable Cables: RD316, RD316-FEP

This part number complies with RoHS.

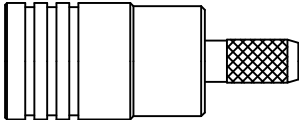

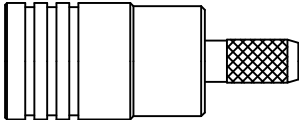

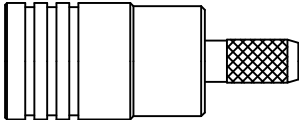

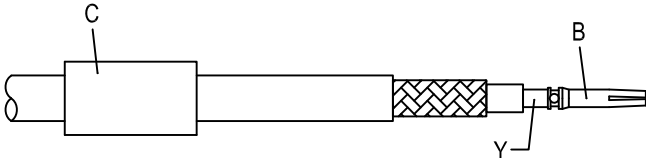
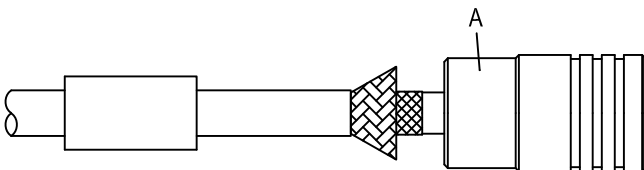
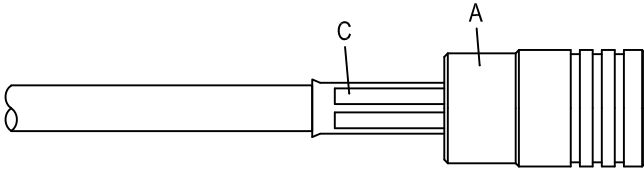
Notice: JYBAO reserves the right to make modifications deemed appropriate.

SMB	SMB3100D-0316
Interface MIL-STD-348B Mechanically compatible with SMS	
Electrical Data Impedance 50Ω Frequency range DC to 2GHz VSWR ≤ 1.2 (DC to 2GHz) Insertion loss $\leq 0.1 \times \sqrt{f(\text{GHz})}$ dB Insulation resistance $\geq 10000\text{M}\Omega$ Contact resistance inner conductor $\leq 5\text{m}\Omega$ Contact resistance outer conductor $\leq 2.5\text{m}\Omega$ Dielectric withstanding voltage (at sea level) 1000 V rms Working Voltage (at sea level) 335 V rms	
Mechanical Data Disengagement force 1.8 to 14.2 lbs Engagement force 1.8 to 14.2 lbs Contact captivation-axial ≥ 4 lbs Durability (mating) ≥ 500	
Environmental Data Temperature range -65°C to +165°C Thermal shock MIL-STD-202, Method 107, Condition B Moisture resistance MIL-STD-202, Method 106 Corrosion MIL-STD-202, Method 101, Condition B RoHS Compliant	
Tooling Crimping tool CRT-1 or CRT-2 Crimp insert INSERT-A	

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

SMB3100D-0316		DATE	2017/09/05	REV	—									
<table><tr><td>A</td><td>B</td><td>C</td></tr><tr><td></td><td></td><td></td></tr><tr><td>BODY</td><td>CONTACT PIN</td><td>FERRULE</td></tr></table>						A	B	C				BODY	CONTACT PIN	FERRULE
A	B	C												
														
BODY	CONTACT PIN	FERRULE												
DIAGRAM			ASSEMBLY INSTRUCTION											
			Step 1: STRIP AS SHOWN.											
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: PUT PIN " B " ON CENTER CONDUCTOR AND CRIMP IN " Y ". (USE SQUARE 0.7mm/0.028inch SECTION OF INSERT-A)											
			Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE.											
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 3.3mm/0.130inch HEX SECTION OF INSERT-A)											
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.														
APPROVED		CHECKED		DRAWING										
				Albert										

SMB3100D-0316

S11

