

SMB3100W-9058

SMB Plug Crimp Right Angle

For RG58,JBY195,LMR195; 4GHz VSWR 1.2

50Ω

Technical drawing of the SMB Plug Crimp Right Angle connector. The drawing shows a side view of the connector with the following dimensions:

- Overall length: 15.7 inches (.618)
- Length of the main body: 14.25 inches (.561)
- Outer diameter of the main body: 4.4 inches (ø.173)
- Outer diameter of the contact pin: 3.1 inches (ø.122)

Parts	Material	Plating (Micro-inch)
Ferrule	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Contact Pin	Phosphor Bronze	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Retainer Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Cover	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20

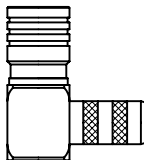
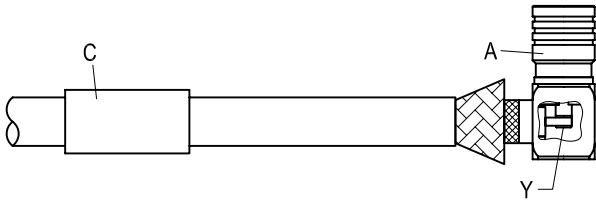
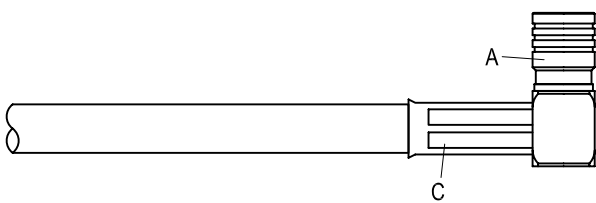
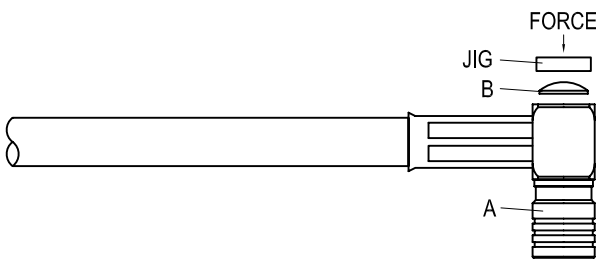
Suitable Cables: RG58, JBY195, LMR195

SMB	SMB3100W-9058
Interface MIL-STD-348B Mechanically compatible with SMS	
Electrical Data Impedance 50Ω Frequency range DC to 4GHz VSWR ≤ 1.2 (DC to 4GHz) Insertion loss $\leq 0.1 \times \sqrt{f(\text{GHz})}$ dB Insulation resistance $\geq 10000\text{M}\Omega$ Contact resistance inner conductor $\leq 5\text{m}\Omega$ Contact resistance outer conductor $\leq 2.5\text{m}\Omega$ Dielectric withstanding voltage (at sea level) 1000 V rms Working Voltage (at sea level) 335 V rms	
Mechanical Data Disengagement force 1.8 to 14.2 lbs Engagement force 1.8 to 14.2 lbs Contact captivation-axial ≥ 4 lbs Durability (mating) ≥ 500	
Environmental Data Temperature range -65°C to +165°C Thermal shock MIL-STD-202, Method 107, Condition B Moisture resistance MIL-STD-202, Method 106 Corrosion MIL-STD-202, Method 101, Condition B RoHS Compliant	
Tooling Crimping tool CRT-1 or CRT-2 Crimp insert INSERT-B	

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

SMB3100W-9058		DATE	2017/06/12	REV	—
A  BODY B  COVER C  FERRULE					
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: WRAP THE BRAIDING UPWARDS. Step 4: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR " A " AND SOLDER IN " Y ".		
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 5.5mm/0.217inch HEX SECTION OF INSERT-B)		
			Step 6: PRESS ON THE TOP OF " B " WITH JIGS.		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	

SMB3100W-9058

S11

