



SMB8105S-0316

**Stainless SMB Jack
Crimp For Bulkhead**

50Ω

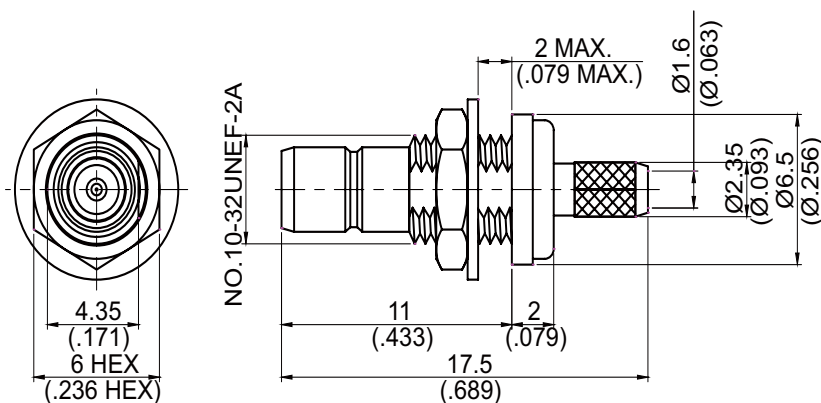

MOUNTING HOLE

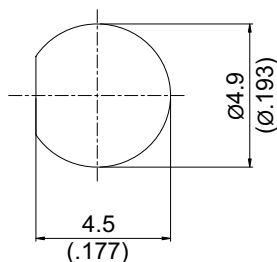

Parts	Material	Plating (Micro-inch)
Hex Nux	Brass	Gold 5 Over Nickel 50 Over Copper 50
Lock Washer	Brass	Gold 5 Over Nickel 50 Over Copper 50
Ferrule	Brass	Gold 5 Over Nickel 50 Over Copper 50
Contact Pin	Stainless Steel	Gold 20 Over Nickel 50 Over Copper 50
Insulator	Teflon	
Barrel	Brass	Gold 5 Over Nickel 50 Over Copper 50
Body	Stainless Steel	Passivated

Weight:

Suitable Cables:RG174, RG188, RG316, RG316-FEP, RG316-LSFH

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

SMB8105S-0316

JYE BAO CO., LTD.

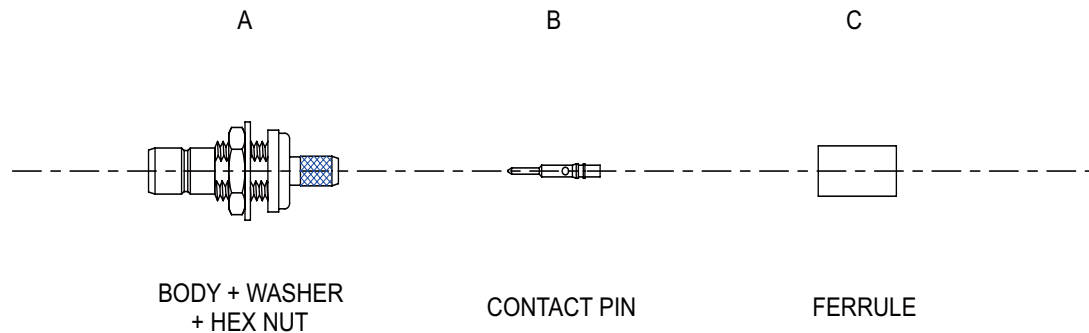


DIAGRAM	ASSEMBLY INSTRUCTION
	Step 1: STRIP AS SHOWN.
	Step 2: SLIDE FERRULE "C" OVER CABLE. Step 3: PUT PIN "B" ON CENTER CONDUCTOR AND SOLDER OR CRIMP IN "Y". (USE SQUARE 0.7mm/0.028inch SECTION OF INSERT-A IF CRIMPED)
	Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR "A" IN PLACE.
	Step 5: SLIDE FERRULE "C" TOWARDS THE CONNECTOR "A" AND CRIMP. (USE 3.3mm/0.130inch HEX SECTION OF INSERT-A)

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.