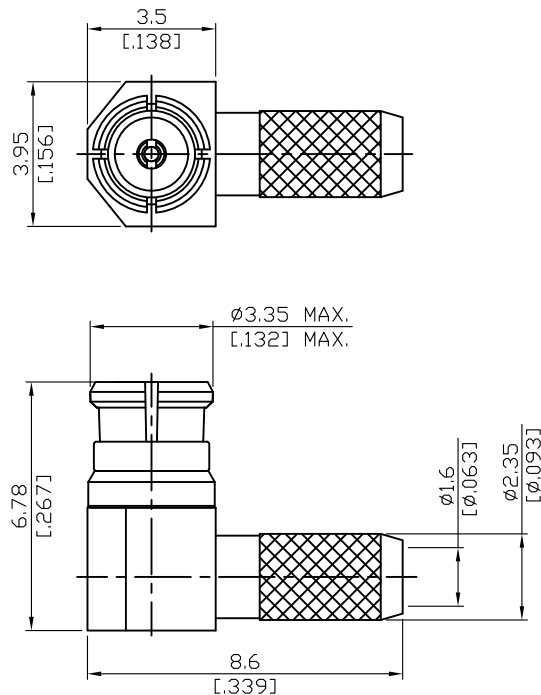


SMP8100D-9316

SMP Jack Crimp Right Angle
For RD316,RD316-FEP; 8GHz VSWR 1.2 50Ω



Parts	Material	Plating (Micro-inch)
Ferrule	Copper	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Cover	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Body	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Renber Ring	Beryllium Copper	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Contact Pin	Beryllium Copper	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Insulator	Teflon	
Contact Body	Beryllium Copper	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20

Suitable Cables: RD316, RD316-FEP, RD316-LSFH

This part number complies with RoHS.

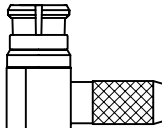

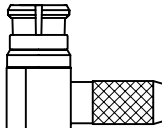

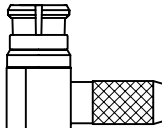

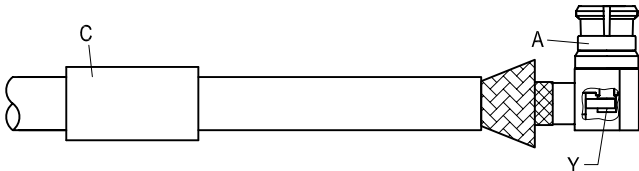
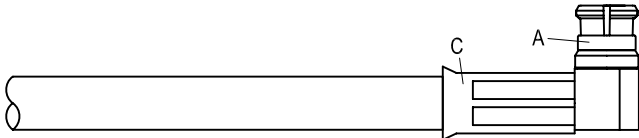
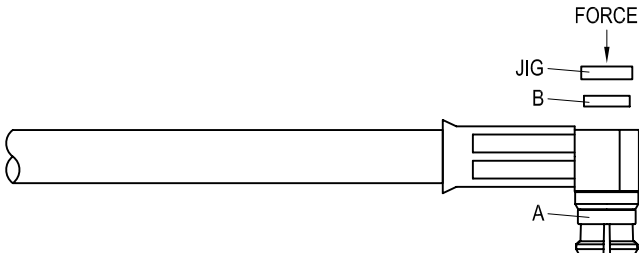
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

SMP		SMP8100D-9316			
Interface					
MIL-STD-348B					
Electrical Data					
Impedance	50Ω				
Frequency range	DC to 8GHz				
VSWR	≤ 1.2 (DC to 8GHz)				
Insertion loss	≤ .06 x √f(GHz) dB				
Insulation resistance	≥ 5000 MΩ				
Contact resistance inner conductor	≤ 6mΩ				
Contact resistance outer conductor	≤ 2mΩ				
Dielectric withstanding voltage (at sea level)	500				
Working Voltage (at sea level)	335				
RF-Leakage	≥ 80dB (3GHz); ≥ 65dB (3~26.5GHz)				
Mechanical Data		Full Detent	Limited Detent	Smooth bore & catchers mit	
Engagement force	≤ 15	≤ 10	≤ 2		lbs
Disengagement force	≥ 5	≥ 2	≥ 0.5		lbs
Durability (mating)	≥ 100	≥ 500	≥ 1000		
Axial misalignment	+ 0.00 / -0.25 (+.000 / -.010)				
Radial misalignment	±0.25 (0.010)				
Environmental Data					
Temperature range	-65°C to +165°C				
Thermal shock	MIL-STD-202, Method 107, Condition B				
Moisture resistance	MIL-STD-202, Method 106				
Corrosion	MIL-STD-202, Method 101, Condition B				
RoHS	Compliant				
Tooling					
Crimping tool	CRT-1 or CRT-2				
Crimp insert	INSERT-A				

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

SMP8100D-9316		DATE	2016/07/20	REV	—									
<table><tr><td>A</td><td>B</td><td>C</td></tr><tr><td></td><td></td><td></td></tr><tr><td>BODY</td><td>COVER</td><td>FERRULE</td></tr></table>						A	B	C				BODY	COVER	FERRULE
A	B	C												
														
BODY	COVER	FERRULE												
DIAGRAM			ASSEMBLY INSTRUCTION											
			Step 1: STRIP AS SHOWN.											
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: WRAP THE BRAIDING UPWARDS. Step 4: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR " A " AND SOLDER IN " Y ".											
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 3.3mm/0.130inch HEX SECTION OF INSERT-A)											
			Step 6: PRESS ON THE TOP OF " B " WITH JIGS.											
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.														
APPROVED		CHECKED		DRAWING										
				Albert										

SMP8100D-9316

S11

