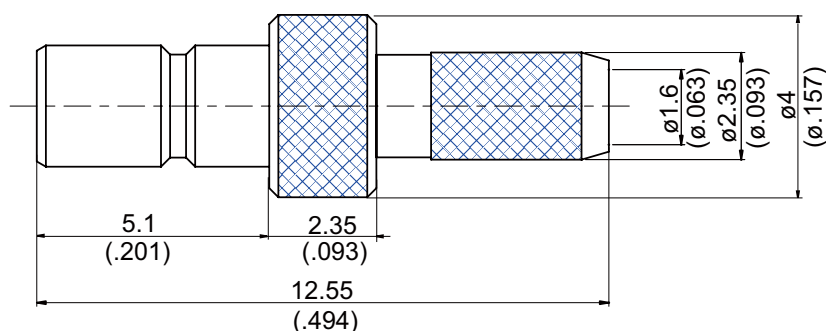


SSMB8100-0316

SSMB jack crimp
For RG174,RG188,RG316; 3GHz VSWR 1.2 **50Ω**



Parts	Material	Plating(Micro-inch)
Contact Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Insulator	Teflon	
Body	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20

Weight: 0.74 g

Suitable Cables: RG174, RG188, RG316, RG316-FEP

This Part number complies with RoHS.


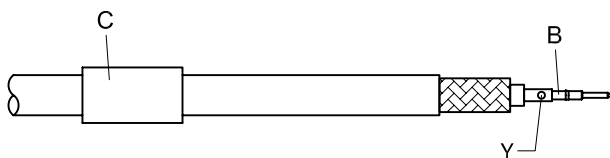


Notice: JYEBAO reserves the right to make modifications deemed appropriate.

SSMB	SSMB8100-0316																				
Interface MIL-STD-348B																					
Electrical Data <table> <tr> <td>Impedance</td><td>50Ω</td></tr> <tr> <td>Frequency range</td><td>DC to 3GHz</td></tr> <tr> <td>VSWR</td><td>≤ 1.2 (DC to 3GHz)</td></tr> <tr> <td>Insertion loss</td><td>≤ 0.1dB (DC to 1GHz)</td></tr> <tr> <td>Insulation resistance</td><td>≥ 5000MΩ</td></tr> <tr> <td>Contact resistance inner conductor</td><td>≤ 5mΩ</td></tr> <tr> <td>Contact resistance outer conductor</td><td>≤ 2.5mΩ</td></tr> <tr> <td>Dielectric withstanding voltage (at sea level)</td><td>500 V rms</td></tr> <tr> <td>Working Voltage (at sea level)</td><td>275 V rms</td></tr> <tr> <td>RF- leakage</td><td>≥ 40dB to 1GHz</td></tr> </table>		Impedance	50Ω	Frequency range	DC to 3GHz	VSWR	≤ 1.2 (DC to 3GHz)	Insertion loss	≤ 0.1dB (DC to 1GHz)	Insulation resistance	≥ 5000MΩ	Contact resistance inner conductor	≤ 5mΩ	Contact resistance outer conductor	≤ 2.5mΩ	Dielectric withstanding voltage (at sea level)	500 V rms	Working Voltage (at sea level)	275 V rms	RF- leakage	≥ 40dB to 1GHz
Impedance	50Ω																				
Frequency range	DC to 3GHz																				
VSWR	≤ 1.2 (DC to 3GHz)																				
Insertion loss	≤ 0.1dB (DC to 1GHz)																				
Insulation resistance	≥ 5000MΩ																				
Contact resistance inner conductor	≤ 5mΩ																				
Contact resistance outer conductor	≤ 2.5mΩ																				
Dielectric withstanding voltage (at sea level)	500 V rms																				
Working Voltage (at sea level)	275 V rms																				
RF- leakage	≥ 40dB to 1GHz																				
Mechanical Data <table> <tr> <td>Engagement force</td><td>1.8 to 6.1 lbs</td></tr> <tr> <td>Disengagement force</td><td>1.8 to 6.1 lbs</td></tr> <tr> <td>Contact captivation-axial</td><td>≥ 1.8 lbs</td></tr> <tr> <td>Durability (mating)</td><td>≥ 500</td></tr> </table>		Engagement force	1.8 to 6.1 lbs	Disengagement force	1.8 to 6.1 lbs	Contact captivation-axial	≥ 1.8 lbs	Durability (mating)	≥ 500												
Engagement force	1.8 to 6.1 lbs																				
Disengagement force	1.8 to 6.1 lbs																				
Contact captivation-axial	≥ 1.8 lbs																				
Durability (mating)	≥ 500																				
Environmental Data <table> <tr> <td>Temperature range</td><td>-65°C to +165°C</td></tr> <tr> <td>Thermal shock</td><td>MIL-STD-202, Method 107, Condition A</td></tr> <tr> <td>Moisture resistance</td><td>MIL-STD-202, Method 106</td></tr> <tr> <td>Corrosion</td><td>MIL-STD-202, Method 101, Condition B</td></tr> <tr> <td>RoHS</td><td>Compliant</td></tr> </table>		Temperature range	-65°C to +165°C	Thermal shock	MIL-STD-202, Method 107, Condition A	Moisture resistance	MIL-STD-202, Method 106	Corrosion	MIL-STD-202, Method 101, Condition B	RoHS	Compliant										
Temperature range	-65°C to +165°C																				
Thermal shock	MIL-STD-202, Method 107, Condition A																				
Moisture resistance	MIL-STD-202, Method 106																				
Corrosion	MIL-STD-202, Method 101, Condition B																				
RoHS	Compliant																				
Tooling <table> <tr> <td>Crimping tool</td><td>CRT-1 or CRT-2</td></tr> <tr> <td>Crimp insert</td><td>INSERT-A</td></tr> </table>		Crimping tool	CRT-1 or CRT-2	Crimp insert	INSERT-A																
Crimping tool	CRT-1 or CRT-2																				
Crimp insert	INSERT-A																				

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

SSMB8100-0316		DATE	2017/04/18	REV	—
A		B		C	
					
BODY		CONTACT PIN		FERRULE	
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: PUT PIN " B " ON CENTER CONDUCTOR AND SOLDER IN " Y ".		
			Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE.		
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 3.3mm/0.130inch HEX SECTION OF INSERT-A)		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	

SSMB8100-0316

S11

