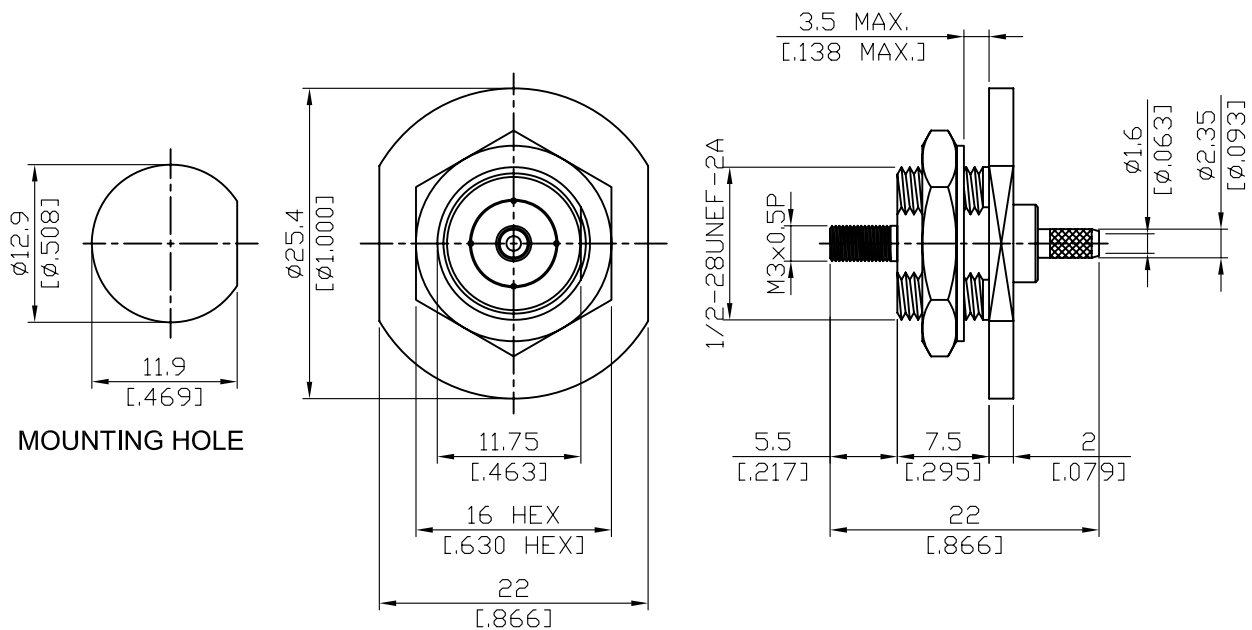


TER0500-0316

Terminal Crimp Bulkhead
For RG174,RG188,RG316



Parts	Material	Plating (Micro-inch)
Ferrule	Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Hex Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	P.Bronze	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

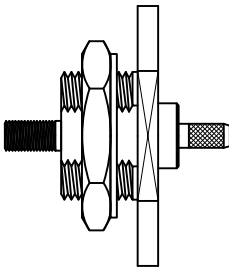
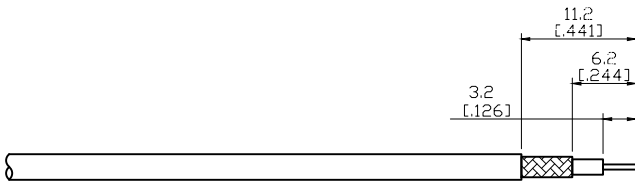


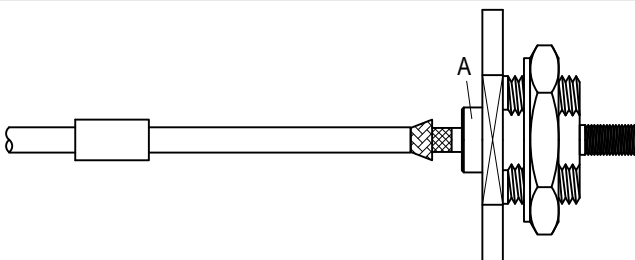
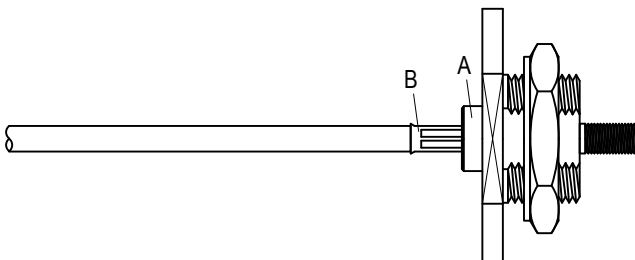
Suitable Cables: RG174, RG188, RG316

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications demand appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

TER0500-0316		DATE	2015/11/02	REV	—
A  BODY + GASKET + WASHER + HEX NUT		B  FERRULE			
DIAGRAM		ASSEMBLY INSTRUCTION			
		Step 1: STRIP AS SHOWN.			
 SHARPEN		Step 2: SHARPEN CENTER CONDUCTOR TIP.			
		Step 3: SLIDE FERRULE " B " OVER CABLE.			
		Step 4: SLIDE CABLE INTO CONNECTOR BODY " A ". Step 5: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE.			
		Step 6: SLIDE FERRULE " B " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 3.3mm/0.130inch HEX SECTION OF INSERT-A)			
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	