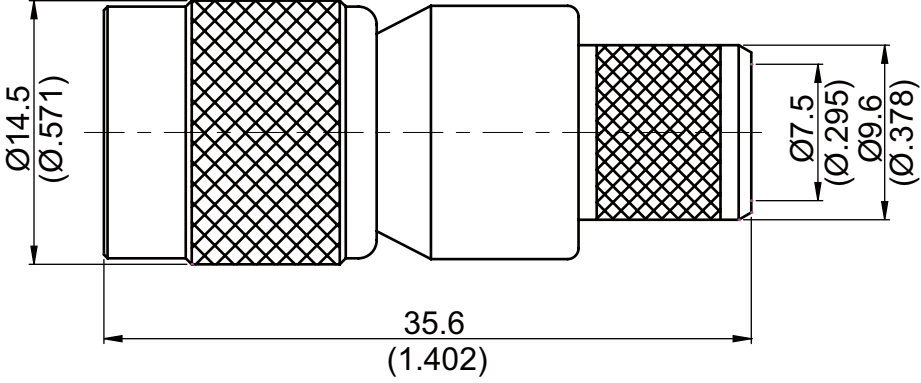


TNC3100-0011	TNC Plug Crimp For RG11; 2GHz VSWR 1.2	75Ω																														
																																
<table border="1"> <thead> <tr> <th>Parts</th><th>Material</th><th>Plating (Micro-inch)</th></tr> </thead> <tbody> <tr> <td>Ferrule</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> <tr> <td>Center Pin</td><td>Brass</td><td>Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20</td></tr> <tr> <td>Gasket</td><td>Silicon</td><td></td></tr> <tr> <td>Ring</td><td>Delrin</td><td></td></tr> <tr> <td>Washer</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> <tr> <td>Barrel</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> <tr> <td>Insulator</td><td>Teflon</td><td></td></tr> <tr> <td>Body</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> <tr> <td>Coupling Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> </tbody> </table>	Parts	Material	Plating (Micro-inch)	Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Center Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20	Gasket	Silicon		Ring	Delrin		Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Insulator	Teflon		Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50		
Parts	Material	Plating (Micro-inch)																														
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																														
Center Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20																														
Gasket	Silicon																															
Ring	Delrin																															
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																														
Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																														
Insulator	Teflon																															
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																														
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																														
Weight: 22.09 g Suitable Cables: RG11																																

This part number complies with RoHS.



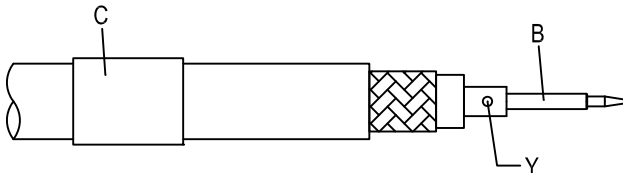
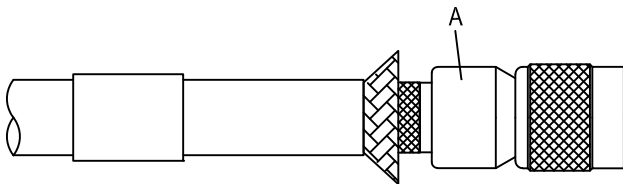
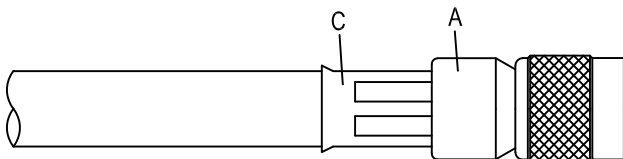
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

TNC	TNC3100-0011																		
Interface MIL-STD-348B																			
Electrical Data <table> <tr> <td>Impedance</td><td>75Ω</td></tr> <tr> <td>Frequency range</td><td>DC to 2GHz</td></tr> <tr> <td>VSWR</td><td>≤ 1.2 (DC to 2GHz)</td></tr> <tr> <td>Insertion loss</td><td>$\leq 0.1 \times \sqrt{f(\text{GHz})}$ dB</td></tr> <tr> <td>Insulation resistance</td><td>$\geq 5000\text{M}\Omega$</td></tr> <tr> <td>Contact resistance inner conductor</td><td>$\leq 1.5\text{m}\Omega$</td></tr> <tr> <td>Contact resistance outer conductor</td><td>$\leq 1\text{m}\Omega$</td></tr> <tr> <td>Dielectric withstanding voltage (at sea level)</td><td>1500 V rms</td></tr> <tr> <td>Working voltage (at sea level)</td><td>500 V rms</td></tr> </table>		Impedance	75Ω	Frequency range	DC to 2GHz	VSWR	≤ 1.2 (DC to 2GHz)	Insertion loss	$\leq 0.1 \times \sqrt{f(\text{GHz})}$ dB	Insulation resistance	$\geq 5000\text{M}\Omega$	Contact resistance inner conductor	$\leq 1.5\text{m}\Omega$	Contact resistance outer conductor	$\leq 1\text{m}\Omega$	Dielectric withstanding voltage (at sea level)	1500 V rms	Working voltage (at sea level)	500 V rms
Impedance	75Ω																		
Frequency range	DC to 2GHz																		
VSWR	≤ 1.2 (DC to 2GHz)																		
Insertion loss	$\leq 0.1 \times \sqrt{f(\text{GHz})}$ dB																		
Insulation resistance	$\geq 5000\text{M}\Omega$																		
Contact resistance inner conductor	$\leq 1.5\text{m}\Omega$																		
Contact resistance outer conductor	$\leq 1\text{m}\Omega$																		
Dielectric withstanding voltage (at sea level)	1500 V rms																		
Working voltage (at sea level)	500 V rms																		
Mechanical Data <table> <tr> <td>Recommended coupling nut torque</td><td>4.1 to 6.1 inch lbs</td></tr> <tr> <td>Coupling proof torque</td><td>15 inch lbs</td></tr> <tr> <td>Coupling nut retention force</td><td>≥ 101.2 lbs</td></tr> <tr> <td>Contact captivation-axial</td><td>≥ 6.1 lbs</td></tr> <tr> <td>Durability (mating)</td><td>≥ 500</td></tr> </table>		Recommended coupling nut torque	4.1 to 6.1 inch lbs	Coupling proof torque	15 inch lbs	Coupling nut retention force	≥ 101.2 lbs	Contact captivation-axial	≥ 6.1 lbs	Durability (mating)	≥ 500								
Recommended coupling nut torque	4.1 to 6.1 inch lbs																		
Coupling proof torque	15 inch lbs																		
Coupling nut retention force	≥ 101.2 lbs																		
Contact captivation-axial	≥ 6.1 lbs																		
Durability (mating)	≥ 500																		
Environmental Data <table> <tr> <td>Temperature range</td><td>-65°C to +165°C</td></tr> <tr> <td>Thermal shock</td><td>MIL-STD-202, Method 107, Condition B</td></tr> <tr> <td>Moisture resistance</td><td>MIL-STD-202, Method 106</td></tr> <tr> <td>Corrosion</td><td>MIL-STD-202, Method 101, Condition B</td></tr> <tr> <td>RoHS</td><td>Compliant</td></tr> </table>		Temperature range	-65°C to +165°C	Thermal shock	MIL-STD-202, Method 107, Condition B	Moisture resistance	MIL-STD-202, Method 106	Corrosion	MIL-STD-202, Method 101, Condition B	RoHS	Compliant								
Temperature range	-65°C to +165°C																		
Thermal shock	MIL-STD-202, Method 107, Condition B																		
Moisture resistance	MIL-STD-202, Method 106																		
Corrosion	MIL-STD-202, Method 101, Condition B																		
RoHS	Compliant																		
Tooling <table> <tr> <td>Crimping tool</td><td>CRT-1 or CRT-2</td></tr> <tr> <td>Crimp insert</td><td>INSERT-C</td></tr> </table>		Crimping tool	CRT-1 or CRT-2	Crimp insert	INSERT-C														
Crimping tool	CRT-1 or CRT-2																		
Crimp insert	INSERT-C																		

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

TNC3100-0011		DATE	2014/04/29	REV	—
A		B		C	
					
BODY		CONTACT PIN		FERRULE	
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE "C" OVER CABLE. Step 3: PUT PIN "B" ON CENTER CONDUCTOR AND SOLDER OR CRIMP IN "Y". (USE 3.3mm/0.130inch HEX SECTION OF INSERT-C IF CRIMPED)		
			Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR "A" IN PLACE.		
			Step 5: SLIDE FERRULE "C" TOWARDS THE CONNECTOR "A" AND CRIMP. (USE 10.7mm/0.421inch HEX SECTION OF INSERT-C)		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	

TNC3100-0011

S11

