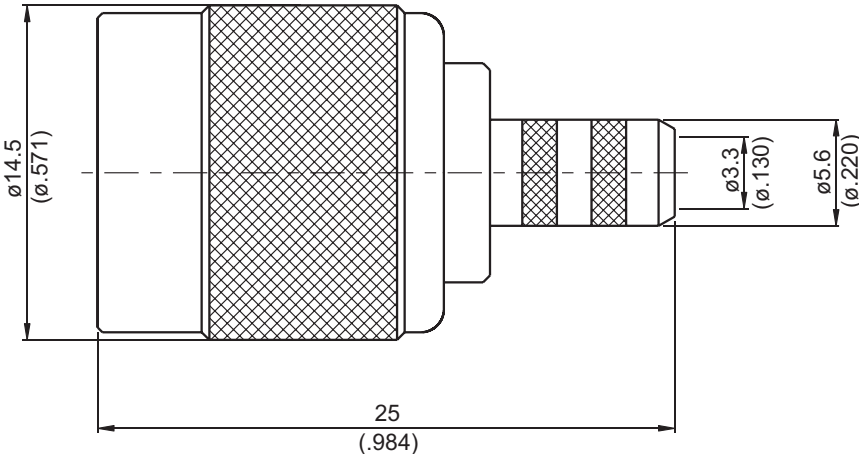


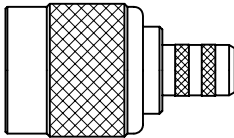

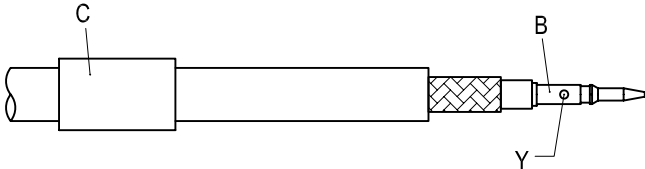
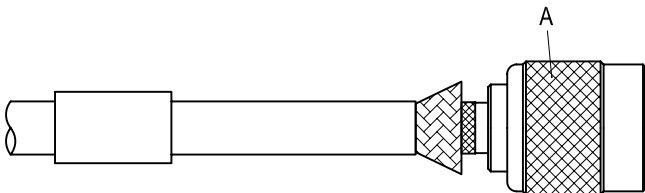
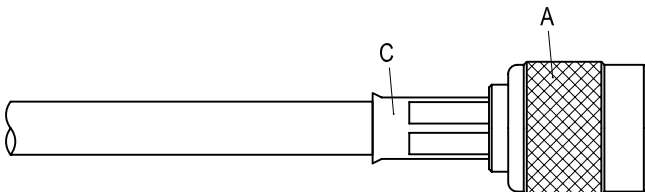
TNC3100-03C2	TNC Plug Crimp	75Ω																											
																													
<table><tr><th>Parts</th><th>Material</th><th>Plating (Micro-inch)</th></tr><tr><td>Ferrule</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Contact Pin</td><td>Brass</td><td>Gold 3 Over Nickel 50 Over Copper 50</td></tr><tr><td>Gasket</td><td>Silicon</td><td></td></tr><tr><td>Ring</td><td>Delrin</td><td></td></tr><tr><td>Washer</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Insulator</td><td>Teflon</td><td></td></tr><tr><td>Body</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Coupling Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr></table>			Parts	Material	Plating (Micro-inch)	Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Contact Pin	Brass	Gold 3 Over Nickel 50 Over Copper 50	Gasket	Silicon		Ring	Delrin		Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Insulator	Teflon		Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Parts	Material	Plating (Micro-inch)																											
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																											
Contact Pin	Brass	Gold 3 Over Nickel 50 Over Copper 50																											
Gasket	Silicon																												
Ring	Delrin																												
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																											
Insulator	Teflon																												
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																											
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																											
Weight: Suitable Cables: 3C-2W																													

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

TNC3100-03C2		DATE	2014/04/18	REV	—
A		B		C	
					
BODY		CONTACT PIN		FERRULE	
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: PUT PIN " B " ON CENTER CONDUCTOR AND SOLDER OR CRIMP IN " Y ". (USE SQUARE 1.6mm/0.063inch SECTION OF INSERT-E IF CRIMPED)		
			Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE.		
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 6.75mm/0.266inch HEX SECTION OF INSERT-E)		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	