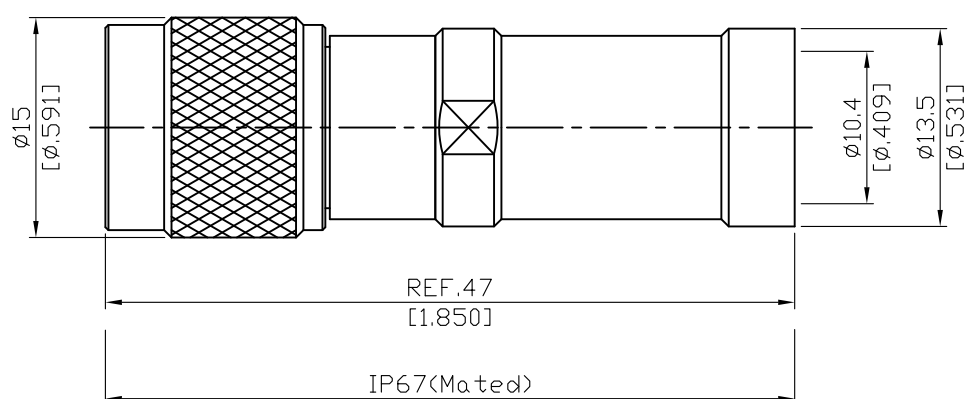


TNC3100-L400/IP67

TNC Plug Crimp For JBY400, LMR400;
IP67 Mated; 6GHz VSWR 1.2

50Ω



Parts	Material	Plating (Micro-inch)
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Teflon	
Contact Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Gasket	Silicone	
Retainer Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Suitable Cables: JBY400; LMR400

This part number complies with RoHS.



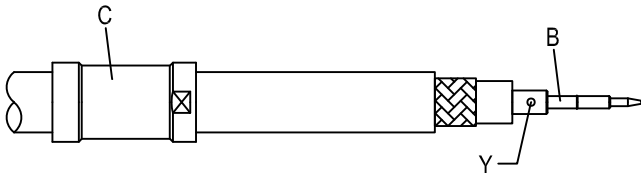
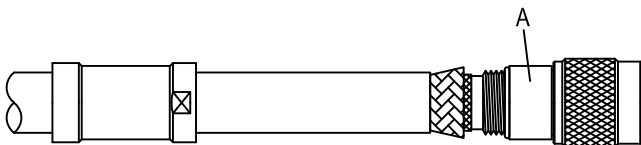
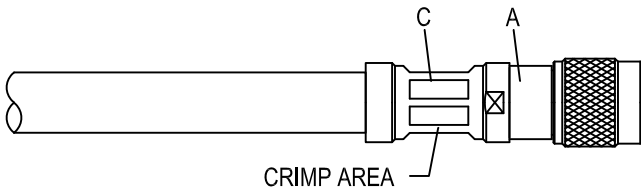


Notice: JYEBAO reserves the right to make modifications deemed appropriate.

TNC	TNC3100-L400/IP67
Interface MIL-STD-348B	
Electrical Data Impedance 50Ω Frequency range DC to 6GHz VSWR ≤ 1.2 (DC to 6GHz) Insertion loss $\leq 0.1 \times \sqrt{f(\text{GHz})}$ dB Insulation resistance $\geq 5000\text{M}\Omega$ Contact resistance inner conductor $\leq 1.5\text{m}\Omega$ Contact resistance outer conductor $\leq 1\text{m}\Omega$ Dielectric withstanding voltage (at sea level) 1500 V rms Working voltage (at sea level) 500 V rms	
Mechanical Data Recommended coupling nut torque 4.1 to 6.1 inch lbs Coupling proof torque 15 inch lbs Coupling nut retention force ≥ 101.2 lbs Contact captivation-axial ≥ 6.1 lbs Durability (mating) ≥ 500	
Environmental Data Temperature range -65°C to +165°C Thermal shock MIL-STD-202, Method 107, Condition B Moisture resistance MIL-STD-202, Method 106 Corrosion MIL-STD-202, Method 101, Condition B RoHS Compliant	
Tooling Crimping tool CRT-1 or CRT-2 Crimp insert INSERT-A & INSERT-C	

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY RECOMMENDATION

TNC3100-L400/IP67		DATE	2019/09/12	REV	—
A  BODY+GASKET B  CONTACT PIN C  FERRULE+GASKET					
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: PUT PIN " B " ON CENTER CONDUCTOR AND SOLDER OR CRIMP IN " Y ". (USE 3.3mm/0.130inch HEX SECTION OF INSERT-A IF CRIMPED)		
			Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE.		
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 10.7mm/0.421inch HEX SECTION OF INSERT-C) ※ CRIMP THE FERRULE CLOSE TO CONNECTOR BODY.  OK  NG		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	

TNC3100-L400/IP67

