



TNC8105T-0122

TNC Isolated Jack Crimp For Bulkhead 50Ω

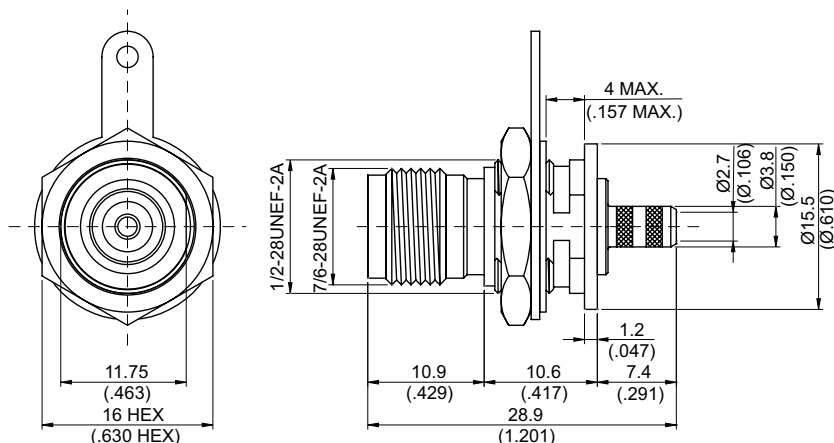

MOUNTING HOLE :

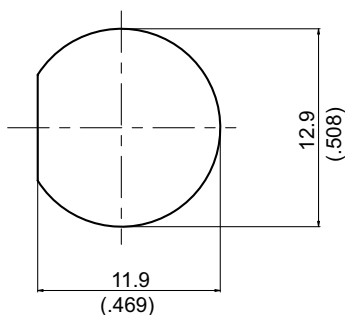

Parts	Material	Plating (Micro-inch)
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Center Pin	Phosphor Bronze	Gold 3 Over Nickel 50 Over Copper 50
Hex Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Solder Tag	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Delrin	
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight:

Suitable Cables: RG122



This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

TNC8105T-0122


JYE BAO CO., LTD.

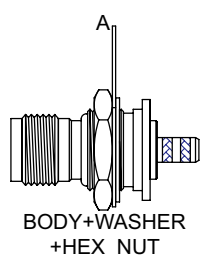

CONTACT PIN




INSULATOR




FERRULE

DIAGRAM

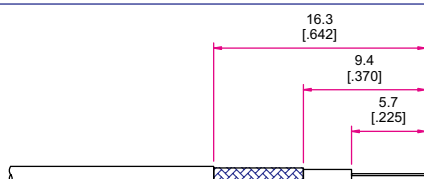


ASSEMBLY INSTRUCTION


Step 1: STRIP AS SHOWN .

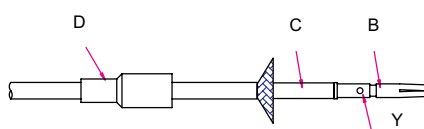

Step 2: SLIDE FERRULE " D " OVER CABLE.
Step 3: LOOSEN BRAIDING AND SLIDE CONNECTOR " C " IN PLACE.
Step 4: PUT PIN " B " ON CENTER CONDUCTOR AND SOLDER IN " Y " .

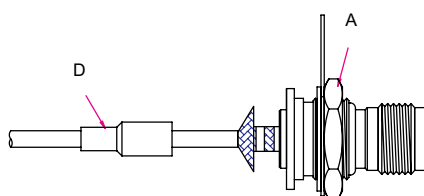

Step 5: SLIDE CONNECTOR " A " IN PLACE.

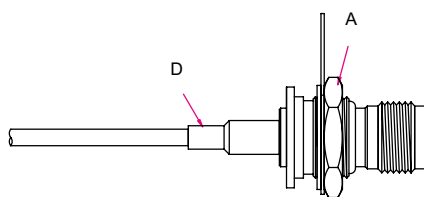

Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP.

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.