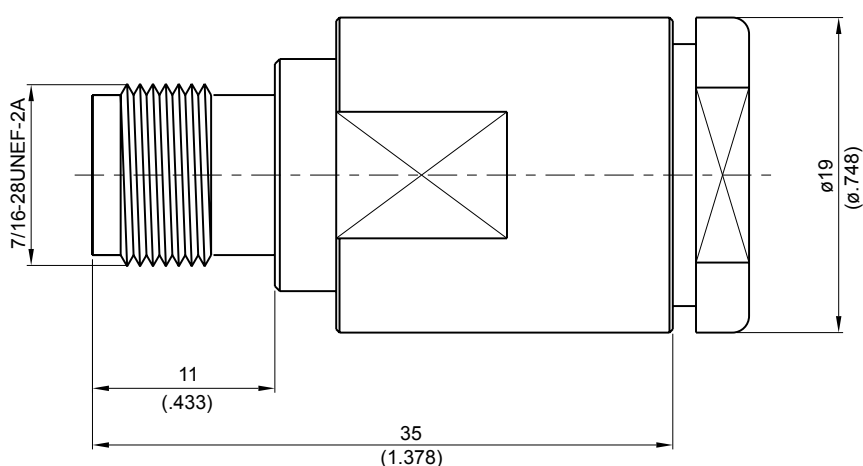


TNC8200B-0011

TNC Jack Clamp

75Ω



Parts	Material	Plating (Micro-inch)
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Phosphor Bronze	Gold 3 Over Nickel 50 Over Copper 50
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight: 41 g



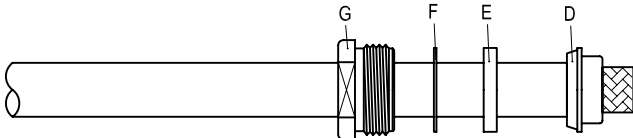
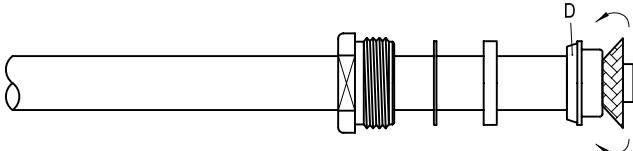
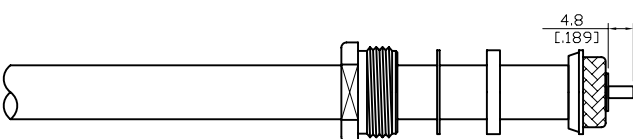
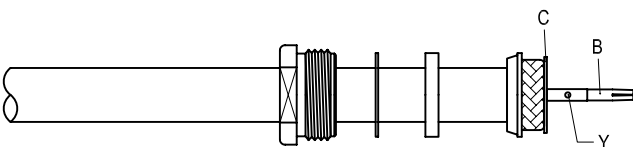
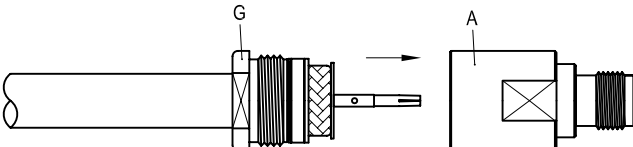
Suitable Cables: RG11

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

TNC8200B-0011			DATE	2016/04/18	REV	—
A	B	C	D	E	F	G
						
BODY	CONTACT PIN	WASHER	BRAID CLAMP	GASKET	WASHER	NUT
DIAGRAM			ASSEMBLY INSTRUCTION			
			Step 1: STRIP AS SHOWN.			
			Step 2: SLIDE NUT "G" 、 WASHER "F" 、 GASKET "E" AND BRAID CLAMP "D" OVER CABLE.			
			Step 3: WRAP THE BRAIDING OVER "D" .			
			Step 4: STRIP AS SHOWN.			
			Step 5: SLIDE PREPARED CABLE INTO WASHER "C" . Step 6: PUT CONTACT PIN "B" ON CENTER CONDUCTOR AND SOLDER IN "Y" .			
			Step 7: FINALLY SCREW "G" ON THE CONNECTOR BODY "A" .			
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.						
APPROVED		CHECKED		DRAWING		
				Albert		