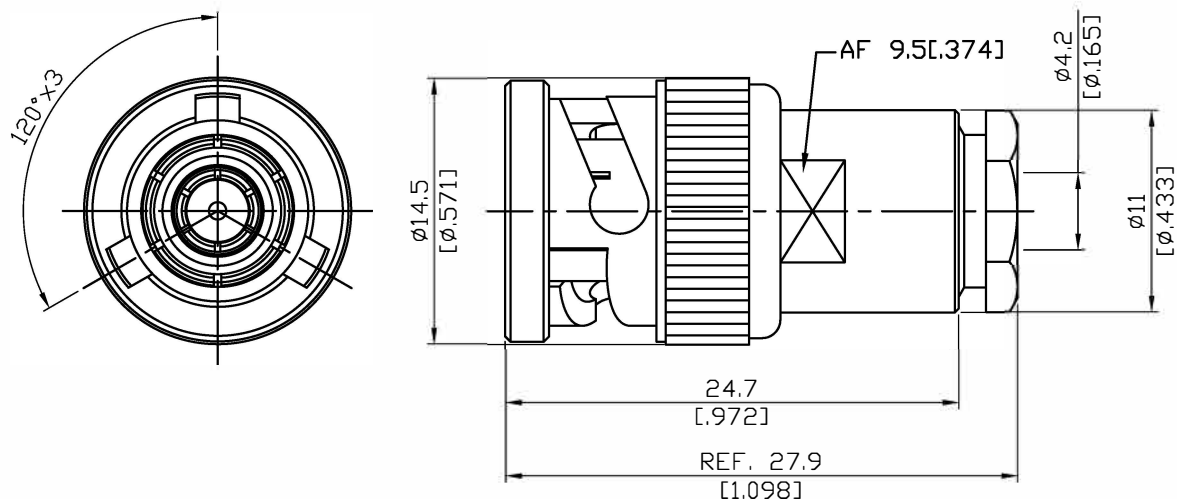


TRAX3200B-TR50

TRB/BNC Plug Clamp Bulkhead
For TRIAX-5001,TRC-50-1



Parts	Material	Plating (Micro-inch)
Coupling Nut	Brass	Nickel 200 Over Copper 50
Body	Brass	Nickel 200 Over Copper 50
Insulator	Teflon	
Washer	Brass	Nickel 200 Over Copper 50
Spring	SK5	Nickel 200 Over Copper 50
Gasket	Silicone	
Contact Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Contact Body	P.Bronze	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Braid Clamp	Brass	Nickel 200 Over Copper 50
Nut	Brass	Nickel 200 Over Copper 50








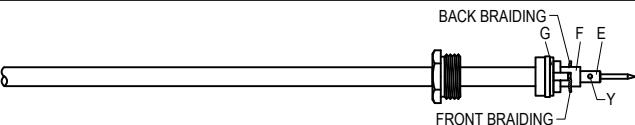



Suitable Cables: TRIAX-5001,TRC-50-1

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY RECOMMENDATION

TRAX3200B-TR50					DATE	2021/12/20	REV	A	
A	B	C	D	E	F	G	H	I	J
									
BODY	INSULATOR	CONTACT BODY	INSULATOR	CONTACT PIN	INSULATOR	GASKET	BRAID CLAMP	WASHER	NUT
DIAGRAM					ASSEMBLY INSTRUCTION				
					Step 1: STRIP AS SHOWN.				
					Step 2: SLIDE NUT " J " AND WASHER " I " OVER CABLE. Step 3: MAKE A 2MM LONG CUT IN THE JACKET WITHOUT DAMAGING THE BRAIDING.				
					Step 4: SLIDE BRAID CLAMP " H " INTO CABLE.				
					Step 5: STRIP AS SHOWN.				
					Step 6: WINDING THE BRAIDING.				
					Step 7: STRIP AS SHOWN.				
					Step 8: PUT GASKET " G " 、 INSULATOR " F " AND CONTACT PIN " E " ON CENTER CONDUCTOR AND SOLDER IN " Y " .				
					Step 9: PUT INSULATOR " D " AND CONTACT BODY " C " ON THE INSULATOR " F " .				
					Step 10: WINDING THE BRAIDING ON THE CONTACT BODY " C " AND SOLDER .				
					Step 11: PUT INSULATOR " B " INTO THE BODY " A " . Step 12: FINALLY SCREW NUT " J " ON THE BODY " A " . (NUT LOCKING WITHOUT SCREW GLUE)				
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.									
APPROVED			CHECKED			DRAWING			
						Albert			